Warranty, Service & Repair

To register your product with the manufacturer, fill out the enclosed warranty card and return it immediately to:

Flowline Inc. 10500 Humbolt Street Los Alamitos, CA 90720.

If for some reason your product must be returned for factory service, contact Flowline Inc. to receive a Material Return Authorization number (MRA) first, providing the following information:

- 1. Part Number, Serial Number
- 2. Name and telephone number of someone who can answer technical questions related to the product and its application.
- 3. Return Shipping Address
- 4. Brief Description of the Symptom
- 5. Brief Description of the Application

Once you have received a Material Return Authorization number, ship the product prepaid in its original packing to:

Flowline Factory Service MRA _____ 10500 Humbolt Street Los Alamitos, CA 90720

To avoid delays in processing your repair, write the MRA on the shipping label. Please include the information about the malfunction with your product. This information enables our service technicians to process your repair order as quickly as possible.





Version 3.1A © 1999 FLOWLINE Inc. All rights reserved. Manual # LU900005 11/99

WARRANTY

Flowline warrants to the original purchaser of its products that such products will be free from defects in material and workmanship under normal use and service for a period which is equal to the shorter of one year from the date of purchase of such products or two years from the date of manufacture of such products.

This warranty covers only those components of the products which are non-moving and not subject to normal wear. Moreover, products which are modified or altered, and electrical cables which are cut to length during installation are not covered by this warranty.

Flowline's obligation under this warranty is solely and exclusively limited to the repair or replacement, at Flowline's option, of the products (or components thereof) which Flowline's examination proves to its satisfaction to be defective. FLOWLINE SHALL HAVE NO OBLIGATION FOR CONSEQUENTIAL DAMAGES TO PERSON-AL OR REAL PROPERTY, OR FOR INJURY TO ANY PERSON.

This warranty does not apply to products which have been subject to electrical or chemical damage due to improper use, accident, negligence, abuse or misuse. Abuse shall be assumed when indicated by electrical damage to relays, reed switches or other components. The warranty does not apply to products which are damaged during shipment back to Flowline's factory or designated service center or are returned without the original casing on the products. Moreover, this warranty becomes immediately null and void if anyone other than service personnel authorized by Flowline attempts to repair the defective products. Products which are thought to be defective must be shipped prepaid and insured to Flowline's factory or a designated service center (the identity and address of which will be provided upon request) within 30 days of the discovery of the defect. Such defective products must be accompanied by proof of the date of purchase.

Flowline further reserves the right to unilaterally wave this warranty and to dispose of any product returned to Flowline where:

- a. There is evidence of a potentially hazardous material present with product.
- b. The product has remained unclaimed at Flowline for longer than 30 days after dutifully requesting disposition of the product.

THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE OF THIS WARRANTY. This warranty and the obligations and liabilities of Flowline under it are exclusive and instead of, and the original purchaser hereby waives, all other remedies, warranties, guarantees or liabilities, express or implied. EXCLUDED FROM THIS WARRANTY IS THE IMPLIED WARRANTY OF FITNESS OF THE PRODUCTS FOR A PARTIC-ULAR PURPOSE OR USE AND THE IMPLIED WARRANTY OF MERCHANT ABILITY OF THE PRODUCTS.

This warranty may not be extended, altered or varied except by a written instrument signed by a duly-authorized officer of Flowline, Inc.

Spec Tech Industrial Electric

www.spectechind.com

SPECIFICATIONS

Step One

Range: Accuracy: Resolution: Frequency: Pulse rate: Beam width: Deadband: Blocking distance: Display type: Display units: Memory: Supply voltage: Max loop resistance Signal output:	0.5 to 18 feet (15 $d \pm 0.25\%$ of span in 0.125" (3 mm) 50 kHz 2 pulses per secon 8° conical 0.5' (15 cm) minir 0.5 to 18 feet (15 $d \pm 15$ $d \pm 1$	cm to 5.4 m) n air d num cm to 5.4 m) (71 mm) (71	2" NF	PT (2" G) PT (2" G) 1.3" (32mn 4.9"(124mm) "(159mm)	Techn An ultra times pe transduc against t returns processo the time generati this figu transmit	ology sonic sound wa er second from er. The sound the process med to the transduc or based elect e of flight betw on and receipt re into the dista ter and process	ve is pulsed two the base of the l wave reflects dium below and cer. The micro- ronics measure ween the sound , and translates nce between the medium below.
Signal invert: Calibration: Fail-safe diagnostics: Temperature rating: Temp. compensation Pressure rating: Enclosure rating: Enclosure material: Transducer material: Mounting threads:	IS: 4-20 mA, 1 IS: 4-20 mA, 1 4-20 mA / 20-4 m. Push button Reverts to 4 mA, 2 F: -40° to 140° C Automatic over en 30 psi (2 bar) @ 2 (.113 bar) per °C. NEMA 4X (IP65) Polypropylene (PF Polyvinylidene Fh 2" NPT (2" G)	 12-30 VDC (see below) 12-32 VDC (see below) A 22 mA or remains constant : -40° to 60° (see below) tire range 25 °C., derated @ 1.667 psi above 25 °C. (see below) P), U.L. 94VO uoride (PVDF) 	NON-	HAZARDOUS LOCATI	ON FC	AZARDOUS LOC lass I, Div I, Groups A, Ultrasonic Level Transmitter Vmax = 32.0 V Imax = 130 mA Ci = 0 μF Li = 0 μH	ATION B, C & D
Mounting gasket: Conduit connection: CE Compliance: CSA Certificate: *GP = General Purpo Temperature//	Viton (2") metric of 1/2" NPT (1/2" BS EN 50082-2 immu EN 55011 emissio LR79326-10 ose IS Intrinsic	only SP) unity n cally Safe Part# Des	cription	Control drawing for the lapproved under the enti	LU20-5001-IS ultra ty concept as an I Coni Rev. NRTL/C Intrinsically Safe/ Securite In Exia	asonic level transm .S. apparatus trol Drawing: LU20 7-24-97 LR79326-10 ttrinseque	itter 0CD
(isd) = 25 - Acceptabl 15 - Range - Acceptabl 10 - Range 	e e 20 40 60 ature (°C)	LU20-5001 Gene LU20-5061 Gene LU20-5001-IS Intrin LU20-5061-IS Intrin	ral Purpose ral Purpose usically Safe usically Safe	2" NPT 2" G 2" NPT 2" G	For use in Hazardous Local Class I, Group Class II, Group Class II, Group Class II, Group SII Temperature C an approved LS. bai Parameters Wax = 32.0 VD $M_{ex} = 32.0 \text{ VD}$ $M_{ex} = 130 \text{ mA}$ $C = 0 \mu F$ $L = 0 \mu H$ Warning: Suitable for Cl C & D; Class II, Groups	ions: 15 A, B, C & D ps E, F & G iode: T3C ren used with rrier. Entity XC ass I, Groups A, B, E, F & G, Class III,	
Maximum Tempera Continuous 20 mA entinuous 20 mA ent	ture/Voltage Derating Curve (LU20-50_1)	Definition of the second secon	ge Derating 20-50_1-IS)		T3C; when used with an barrier. Substitution of cr impair intrinsic safety LL requirements for Intrinsic operation	approved I.S. omponents may 120-50X1-IS cally Safe	
$ \begin{array}{c} \begin{array}{c} \begin{array}{c} 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 $			Warning A The LU20 is a loop powered device. The load should never exceed 900 Ohms. LU20-50_1-IS must be installed in accordance with drawing LU20CD rev B (see steps) for safe operation in a hazardous area.				
			When installing the LU20, never tighten the transmitter from the body. Always use the wrench flat located above the threads. Always install the 2" Viton gasket with the LU20-5061 and the LU20-5061-IS. The G threaded version of the Echotouch will not seal unless the gasket is installed properly.				

Spec Tech Industrial Electric

www.spectechind.com

SAFETY PRECAUTIONS

Step Two

About this Manual:

PLEASE READ THE ENTIRE MANUAL PRIOR TO INSTALLING OR USING THIS PRODUCT. This manual includes information on all four versions of the continuous ultrasonic level transmitter from Flowline; model LU20-50_1 and LU20-50_1-IS. Please refer to the part number located on the sensor label to verify the exact model which you have purchased.

🗥 User's Responsibility for Safety:

Flowline manufactures a wide range of liquid level sensors and technologies. While each of these technologies are designed to operate in a wide variety of applications, it is the user's responsibility to select a technology that is appropriate for the application, install it properly, perform tests of the installed system, and maintain all components. The failure to do so could result in property damage or serious injury.

Proper Installation and Handling:

Because this is an electrically operated device, only properlytrained staff should install and/or repair this product. Use a proper sealant with all installations. Note: Always install the 2" Viton gasket with the LU20-5061 and the LU20-5061-IS. The G threaded version of the Echotouch will not seal unless the gasket is installed properly. Never overtighten the transmitter within the fitting. Always check for leaks prior to system start-up.

Miring and Electrical:

A supply voltage of 12-36 VDC is used to power the LU20-50_1 transmitter and a supply voltage of 12-32 VDC is used to power the LU20-50_1-IS. The sensor systems should never exceed a maximum of 36 VDC for the LU20-50_1 and 32 VDC for the LU20-50_1-IS. Electrical wiring of the sensor should be performed in accordance with all applicable national, state, and local codes.

✓ Temperature and Pressure:

The LU20 is designed for use in application temperatures from -40 $^{\circ}$ C (-40 $^{\circ}$ F) to 60 $^{\circ}$ C (140 $^{\circ}$ F), and for use at pressures up to 30 psi @ 25 $^{\circ}$ C, derated @ 1.667 psi per $^{\circ}$ C above 25 $^{\circ}$ C.

Material Compatibility:

The continuous ultrasonic level transmitter, LU20, is made of two materials. The enclosure is of Polypropylene (PP) and the transducer is made of Polyvinylidene Fluoride (PVDF). Make sure that the model which you have selected is chemically compatible with the application liquids. While the transmitter housing is liquid-resistant when installed properly, it is not designed to be immersed. It should be mounted in such a way that it does not normally come into contact with fluid.

Flammable, Explosive and Hazardous Applications: Only the LU20-50_1-IS is rated for use in hazardous locations. Refer to the Certificate of Compliance for all applicable intrinsically safe ratings and entity parameters for the LU20-50_1-IS. Refer to the National Electric Code (NEC) for all applicable installation requirements in hazardous locations. DO NOT USE THE LU20-50_1 GENERAL PURPOSE TRANSMITTER IN HAZ-ARDOUS LOCATIONS.

Alake a Fail-Safe System:

Design a fail-safe system that accommodates the possibility of transmitter or power failure. In critical applications, Flowline recommends the use of redundant backup systems and alarms in addition to the primary system.

DEFINITIONS

Step Three



EC4: The 4 mA setting for the LU20. The EC4 is the distance from the bottom of the LU20 to the 4 mA set point. This setting is measured in either inches or centimeters on the display. The EC4 setting is typically greater that the EC20 setting.

EC20: The 20 mA setting for the LU20. The EC20 is the distance from the bottom of the LU20 to the 20 mA set point. This setting is measured in either inches or centimeters on the display. The EC20 setting is typically greater that the EC4 setting.

SAF1/SAF2/SAF3: Fail-Safe setting for the LU20. Use the SAF_ settings to determine a fail-safe mode for the current signal. When [SAF1] is set, the current will increase to 22 mA if the signal becomes LOST. When [SAF2] is set, the current will decrease to 4 mA if the signal becomes LOST. When [SAF3] is set, the current will remain constant if the signal becomes LOST.

FAST/SLOW: Setting for echo averaging on the LU20. [FAST] is the typical setting for the LU20 to operate. [SLOW] is designed to help dampen out effects caused by severe turbulence. In the [FAST] mode, the LU20 will average 2 signal responses per second and update every second. In the [SLOW] mode, the LU20 will average signal returns over the preceding 10 seconds. When used with [SAF 1/2/3], the time for the current to default is 30 seconds for [FAST] mode and 2.5 minutes for [SLOW] mode.

ALIN: Indicates that the unit is in the Alignment mode. Display will show the return signal strength in dB's. Used as an indicator for mechanical alignment of the LU20 and/or signal attenuation. Typical readings range between 2 and 60 dB's. For optimum alignment, first energize the unit and receive a valid return signal. Then select the ALIN mode and adjust the LU20 until the display is maximized.

ON/OFF: Actual setting for ALIN mode. The ALIN mode must be turned [OFF] when alignment is completed. This mode will not automatically default back to [LEVL].

MAXR: Used as an indication for [MAXR] or maximum range. The MAXR sets the maximum tank height and will filter out all returns greater than this value.

(value): Actual MAXR setting. The maximum distance is 216.0 inches.

MINR: Used as an indication for [MINR] or the minimum range. The MINR value is the deadband closest to the transducer face where no signal will be generated. The MINR sets the minimum distance between the liquid and the transducer.



(value): Actual MINR setting. The minimum distance is 6.0 inches.

Spec Tech Industrial Electric

www.spectechind.com

PROGRAMMING

Step Four

EC4:

- 1. Hold [MENU] key until EC4 appears in display.
- 2. Release [MENU] key and wait until a value appears. This value is the current measured level value.
- 3. If this is acceptable, press [SET] to lock the value as the new EC4 set point. If not, press either the [▲] or [▼] keys once and the old setting for the EC4 will appear.
- 4. From here, use the $[\blacktriangle]$ or $[\blacktriangledown]$ keys to raise or lower the value to the desired value.
- 5. Press the [SET] key to enter this value as the new EC4 set point.

EC20:

- 1. Hold [MENU] key until EC20 appears in display.
- 2. Release [MENU] key and wait until a value appears. This value is the current measured level value.
- 3. If this is acceptable, press [SET] to lock the value as the new EC20 set point. If not, press either the [▲] or [▼] keys once and the old setting for the EC4 will appear.
- 4. From here, use the $[\blacktriangle]$ or $[\blacktriangledown]$ keys to raise or lower the value to the desired value.
- 5. Press the [SET] key to enter this value as the new EC20 set point.

SAF1/SAF2/SAF3:

- 1. Hold [MENU] key until SAF1, SAF2 or SAF3 appears in the display.
- 2. Release [MENU] key and hold [SET] key to toggle between SAF1, SAF2 and SAF3.
- 3. When desired setting is reached, release [SET] key. The last displayed setting will be locked into memory. To change, start again at step 1.

FAST/SLOW:

- 1. Hold [MENU] key until FAST or SLOW appears in the display.
- 2. Release [MENU] key and hold [SET] key to toggle between FAST and SLOW.
- 3. When desired setting is reached, release [SET] key. The last displayed setting will be locked into memory. To change, start again at step 1.

ALIN:

- 1. Hold [MENU] key until ALIN appears in the display.
- 2. Continue to hold [MENU] key until OFF appears in the display.
- 3. Release [MENU] key and hold [SET] key to toggle from OFF to ON.
- 4. Release [SET] key. The LU20 is now in ALIN mode.
- 5. To exit ALIN mode, repeat steps 1-4 changing from ON to OFF.

MAXR:

- 1. Hold [MENU] key until MAXR appears in the display.
- 2. Continue to hold [MENU] key until a value appears in the display. This value is the current MAXR setting.
- 3. If this is acceptable, press [SET] to lock the value as the MAXR setting. If not, use the [▲] or [▼] keys to raise or lower the value to the desired setting.
- 4. Press the [SET] key to enter this value as the new MAXR setting.

MINR:

- 1. Hold [MENU] key until MINR appears in the display.
- 2. Continue to hold [MENU] key until a value appears in the display. This value is the current MINR setting.
- 3. If this is acceptable, press [SET] to lock the value as the MINR setting. If not, use the [▲] or [▼] keys to raise or lower the value to the desired value.
- 4. Press the [SET] key to enter this value as the new MINR setting.

WIRING

Step Five

The LU20-50_1 requires 12-36 VDC power with at least 25 mA supply in order to operate.

1. Wiring to a Flowline Continuous Controller (Model LC52):



2. Wiring to a Two-Wire Loop Indicator (Model LU20-50_1):



3. Wiring to a PLC (LU20-50_1):



INSTALLATION

Step Six

The LU20-50_1-IS requires 12-32 VDC power with at least 25 mA supply in order to operate. The follow provides an overview of wiring the LU20-50_1-IS to various devices. Please note that a barrier must be installed between the Echotouch and the device and the barrier must be located within the nonhazardous location.

1. Hazardous System Diagram



INSTALLATION

Step Seven

Mounting the LU20 is critical to the successful operation of the transmitter. Avoid the following parameters:



F MINR

If installing the LU20 in a flange or any device which recesses the bottom of the transmitter, use the MINR setting. The minimum value for the MINR setting is the distance from the bottom of the transmitter to the end of the flange. Never set MINR to less than 6.0 inches.

Maximum Application Range

The maximum range of LU20 is 18 feet at 110 dB. Under less than ideal conditions, a number of factors can reduce the overall quality of signal return and shorten the accurate range of the transmitter. To determine the maximum application range of the product, follow the signal return formula against the echo attenuation graph below.

Echo Attenuation Graph



Spec Tech Industrial Electric

INSTALLATION

Step Eight

Factory Settings:

The LU20 is preset at the factory. When powering up the transmitter the first time, the factory settings will be active. If at any time in you need to return to these settings, remove power from the LU20 and wait 10 seconds. Press the [Set] and [Menu] buttons simultaneously while powering up the transmitter.

EC 4	216" (548.4 cm)	OFF	OFF
EC20	8" (20.3 cm)	MAXR	N/A
SAF1/2/3	SAF1	value	216" (548.4 cm)
Fast/Slow	FAST	MINR	N/A
ALIN	N/A	value	6" (15.2 cm)

Changing Display Units:

The LU20 comes preset to measure in inches. To change the unit to display centimeters, remove power to the LU20 and wait 10 seconds. Press $[\blacktriangle]$ and [Set] simultaneously while powering up the transmitter. The LU20 will now read in centimeters. To return to inches, remove power and wait 10 seconds. Press $[\blacktriangledown]$ and [Set] simultaneously while powering up the transmitter.



TROUBLESHOOTING

Step Nine

LOST Signal:

A reading of LOST in the display of the LU20 indicates the transmitter is not receiving a valid return signal. If LOST appears, please check the following troubleshooting items:

- 1. Beam cone interference such as the side wall, ladders, seams, rungs or pipes within the LU20's beam cone.
- 2. Proper installation such that the LU20 is installed level and free from interference from the installation fitting or flange.
- 3. Sufficient power being supplied to the LU20. The LU20-50_1 requires 12-36 VDC power with a minimum supply of 25 mA. The LU20-50_1-IS requires 12-32 VDC power with a minimum supply of 25 mA.
- 4. Proper programming of the MAXR or MINR function. For best results, set the MAXR function as the distance from the bottom of the tank to the bottom of the transmitter. Also set the MINR distance above the highest level in the tank. Do not set the MINR to less than 6 inches.
- 5. Make sure that the transmitter is not installed at an angle. Even a 5 degree offset can reduce the signal return strength greatly.

Other Hints:

Current must change with changes in level. Example: For the illustration below, as level increases, the current output will increase and as the level decreases, the current output will decrease. If the output of the LU20 is always reading 4 mA or 20 mA, check the input values for the LU20.

